



[4910-13-P]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2015-3144; Directorate Identifier 2014-NM-110-AD; Amendment 39-18403; AD 2016-04-09]

RIN 2120-AA64

Airworthiness Directives; Dassault Aviation Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Final rule.

SUMMARY: We are adopting a new airworthiness directive (AD) for certain Dassault Aviation Model FALCON 900EX and FALCON 2000EX airplanes. This AD was prompted by a report of significant fuel leakage at the middle position of the left outboard slat. This AD would require modifying the assembly of the slat extension mechanical stop. We are issuing this AD to prevent failure of the assembly of the slat extension mechanical stop, which if not corrected, could lead to a significant fuel leak and result in an uncontained fire.

DATES: This AD becomes effective [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

ADDRESSES: You may examine the AD docket on the Internet at

<http://www.regulations.gov/#!docketDetail;D=FAA-2015-3144>; or in person at the Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC.

For service information identified in this final rule, contact Dassault Falcon Jet Corporation, Teterboro Airport, P.O. Box 2000, South Hackensack, NJ 07606; telephone 201-440-6700; Internet <http://www.dassaultfalcon.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-3144.

FOR FURTHER INFORMATION CONTACT: Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1137; fax 425-227-1149.

SUPPLEMENTARY INFORMATION:

Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain Dassault Aviation Model FALCON 900EX and FALCON 2000EX airplanes. The NPRM published in the Federal Register on August 21, 2015 (80 FR 50810). The NPRM was prompted by a report of significant fuel leakage at the middle position of the left outboard slat. The NPRM proposed to require modifying

the assembly of the slat extension mechanical stop. We are issuing this AD to prevent failure of the assembly of the slat extension mechanical stop, which if not corrected, could lead to a significant fuel leak and result in an uncontained fire.

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive 2014–0115, dated May 13, 2014 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Dassault Aviation Model FALCON 900EX and FALCON 2000EX airplanes. The MCAI states:

After landing, an airplane experienced a significant fuel leakage at the middle position of the left outboard slat. Investigations showed that the fuel spillage originated in a structural cap, which had been punctured by a broken locking pin of the slat extension mechanical stop.

A design review revealed that the locking pin could become loose due to an incorrect installation combined with a non-fault-tolerant design.

This condition, if not corrected, may lead to a significant fuel leak, possibly resulting in an uncontained fire.

To address this potential unsafe condition, Dassault Aviation developed a modification of the slat extension mechanical stop assembly (Mod M3678 for [Model] F2000EX aeroplanes and Mod M5870 for [Model] F900EX aeroplanes) with the purpose to increase its robustness with regards to possible mishandling on production or during maintenance. Dassault Aviation also published Service Bulletin (SB) F2000EX–344 and SB F900EX–450, for embodiment in service of that modification.

For the reasons described above, this [EASA AD] requires modification of the slat extension mechanical stop assembly.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov/#!documentDetail;D=FAA-2015-3144-0002>.

Comments

We gave the public the opportunity to participate in developing this AD. The following presents the comment received on the NPRM (80 FR 50810, August 21, 2015) and the FAA's response to that comment.

Request to Refer to the Latest Service Information

Dassault Aviation requested that we refer to the latest service information: Erratum Service Bulletin F900EX-450, dated July 16, 2014; and Erratum Service Bulletin F2000EX-344, dated July 16, 2014. Dassault Aviation stated that it issued changes to Dassault Service Bulletin F900EX-450, dated March 10, 2014; and Dassault Service Bulletin F2000EX-344, dated March 10, 2014 (which we referred to as the appropriate sources of service information for accomplishing the actions specified in the proposed AD (80 FR 50810, August 21, 2015)).

We agree with the commenter. Dassault Erratum Service Bulletin F900EX-450, dated July 16, 2014; and Erratum Service Bulletin F2000EX-344, dated July 16, 2014; include among other minor changes, additional illustrations. We have revised paragraph (g) of this AD to refer to Dassault Erratum Service Bulletin F900EX-450, dated July 16, 2014; and Dassault Erratum Service Bulletin F2000EX-344, dated July 16, 2014. We have also added a new paragraph (h) to this AD to provide credit for the actions specified in paragraph (g) of this AD, if those actions are done before the effective date of this AD using Dassault Service Bulletin F900EX-450, dated March 10, 2014; or Dassault Service

Bulletin F2000EX–344, dated March 10, 2014; as applicable. We have redesignated the subsequent paragraphs accordingly.

Conclusion

We reviewed the relevant data and determined that air safety and the public interest require adopting this AD with the changes described previously and minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM (80 FR 50810, August 21, 2015) for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM (80 FR 50810, August 21, 2015).

Related Service Information under 1 CFR part 51

Dassault Aviation has issued Erratum Service Bulletin F900EX–450, dated July 16, 2014; and Erratum Service Bulletin F2000EX–344, dated July 16, 2014. This service information describes procedures for modifying the assembly of the slat extension mechanical stop. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

Costs of Compliance

We estimate that this AD affects 67 airplanes of U.S. registry.

We also estimate that it will take about 8 work-hours per product to comply with the basic requirements of this AD. The average labor rate is \$85 per work-hour. Required

parts will cost about \$3,510 per product. Based on these figures, we estimate the cost of this AD on U.S. operators to be \$280,730, or \$4,190 per product.

Authority for this Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

1. Is not a "significant regulatory action" under Executive Order 12866;

2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);

3. Will not affect intrastate aviation in Alaska; and

4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov/#!docketDetail;D=FAA-2015-3144>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the ADDRESSES section.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39 - AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2016-04-09 Dassault Aviation: Amendment 39-18403. Docket No. FAA-2015-3144; Directorate Identifier 2014-NM-110-AD.

(a) Effective Date

This AD becomes effective [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

(b) Affected ADs

None.

(c) Applicability

This AD applies to Dassault Aviation airplanes specified in paragraphs (c)(1) and (c)(2) of this AD, certificated in any category.

(1) Dassault Aviation Model FALCON 900EX airplanes, all serial numbers on which Dassault Aviation Modification M5281 has been embodied, except those on which Dassault Aviation Modification M5870 has been embodied in production.

(2) Dassault Aviation Model FALCON 2000EX airplanes, all serial numbers on which Dassault Aviation Modification M2846 has been embodied, except those on which Dassault Aviation Modification M3678 has been embodied in production.

(d) Subject

Air Transport Association (ATA) of America Code 57, Wings.

(e) Reason

This AD was prompted by a report of significant fuel leakage at the middle position of the left outboard slat. We are issuing this AD to prevent failure of the assembly of the slat extension mechanical stop, which if not corrected, could lead to a significant fuel leak and result in an uncontained fire.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Modification

Within 9 months or 440 flight hours, whichever occurs first after the effective date of this AD: Modify the assembly of the slat extension mechanical stop, in accordance with Accomplishment Instructions of Dassault Erratum Service Bulletin F900EX-450, dated July 16, 2014; or Dassault Erratum Service Bulletin F2000EX-344, dated July 16, 2014; as applicable.

(h) Credit for Previous Actions

This paragraph provides credit for actions required by paragraph (g) of this AD, if those actions were performed before the effective date of this AD using the applicable service information identified in paragraphs (h)(1) and (h)(2) of this AD, which are not incorporated by reference in this AD.

(1) Dassault Service Bulletin F900EX-450, dated March 10, 2014; and

(2) Dassault Service Bulletin F2000EX-344, dated March 10, 2014.

(i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1137; fax 425-227-1149. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Dassault Aviation's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2014-0115, dated May 13, 2014, for related information. This

MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2015–3144.

(2) Service information identified in this AD that is not incorporated by reference is available at the addresses specified in paragraphs (k)(3) and (k)(4) of this AD.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Dassault Erratum Service Bulletin F900EX–450, dated July 16, 2014. (All pages of this revised service bulletin are marked “Initial issuance” and dated July 16, 2014.)

(ii) Dassault Erratum Service Bulletin F2000EX–344, dated July 16, 2014. (All pages of this revised service bulletin are marked “Initial issuance” and dated July 16, 2014.)

(3) For service information identified in this AD, contact Dassault Falcon Jet Corporation, Teterboro Airport, P.O. Box 2000, South Hackensack, NJ 07606; telephone 201-440-6700; Internet <http://www.dassaultfalcon.com>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to:
<http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on February 15, 2016.

Michael Kaszycki,
Acting Manager,
Transport Airplane Directorate,
Aircraft Certification Service.

[FR Doc. 2016-03694 Filed: 2/29/2016 8:45 am; Publication Date: 3/1/2016]